



Model	Model Code	Model Type
BF175AK1	BAJJ,BAKJ	
BF200AK1	BAEJ,BAFJ	
BF225AK1	BAGJ,BAHJ	

Authorized by MATSUMURA HIROYUKI
Power Product Service Engineering Department, Honda Motor Co.,Ltd

History

Updated	CAAB09	Warranty Application revision	04/Feb/2013
Final	CAAB13	Additional QIC Identification	18/Jan/2013
	CAAB08	Parts Information revision	
Updated	CAAB13	Additional QIC Identification	15/Oct/2012
Updated	CAAB13	Additional QIC Identification	20/Aug/2012
Updated	CZZZ99	Other	15/Nov/2011
Provisional	CZZZ99	Other	30/Jul/2011

Related QIC Report Number(s)

6AH2012036-00, 6ASH2011008-00, 6ASH2011008-02, 6ASH2011008-03, 6ASH2011008-04, 6ASH2012010-01, 6AUH2011004-00, 6HME2011037-00, 6OMC2012002-00, 6OMC2012005-00, 6OMC2012005-01, 6SEM2011007-00, 6SEM2011007-01, 6SEM2012009-02, 6SEM2012009-03, 6SEM2012009-05, 6SEM2012009-07, 6SEM2012009-08, 6SEM2012009-11, 6SEM2012009-12, 6SEM2012009-13, 6SEM2012009-14, 6SEM2012009-18, 6SEM2012009-20, 6SEM2012009-22, 6SEM2012009-23, 6SEM2012009-24, 6SEM2012009-26, 6SEM2012009-27, 6SEM2012009-28, 6UAE2011002-00

After countermeasure O2 sensor failure

Symptom


Dearler check by Dr.H and found that O2 sensor failure, after removed O2 sensor from engine O2 sensor element was found crack.

Causes

Protector exhaust introduction hole at end was leading directly to element, so sea water mist enters directly into sensor element, leading to rapid decrease of element temperature and O2 sensor element cracked.

Countermeasure

Change O2 sensor position (also change exhaust manifold position structure) in order to not to immersion against water.

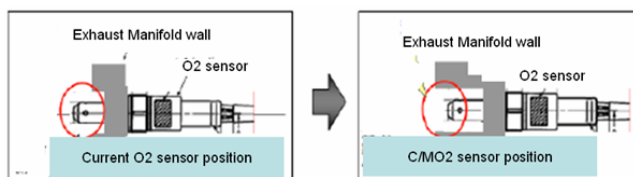

Affected VIN Range

Model		Frame No. Range	
BF175	BAJJ	1300097	1300202
BF175	BAKJ	1300001	1300002
BF200	BAEJ	1600222	1600589
BF200	BAFJ	1600032	1600086
BF225	BAGJ	1601114	1602588
BF225	BAHJ	1600424	1600820

Application on Production Line

Applied Date	Dest.	VIN	COMMENT
03/Jun/2011		BAGJ-1602589	BF225AK1
03/Jun/2011		BAHJ-1600821	BF225AK1
06/Jun/2011		BAEJ-1600590	BF200AK1
06/Jun/2011		BAFJ-1600087	BF200AK1
06/Jun/2011		BAJJ-1300203	BF175AK1
06/Jun/2011		BAKJ-1300003	BF175AK1



Market Treatment

Fix as failed.

Repair Method

Replace to countermeasure exhaust manifold and O2 sensor along with ECU.

Parts Information

Model	C/M Parts number	Description
BF175	34750-ZY4-C05	ECU ASSY
BF200	34750-ZY2-C05	
BF225	34750-ZY3-C06	
Common parts	18120-ZY3-C01ZA	EXHAUST L MANIFOLD COMP.
	35655-ZY3-C01	OXYGEN SENSOR
	18125-ZY3-003	EXH MNFLD GSKT
	91301-ZY3-003	O-RING,66 4,×3.1
	91307-PNA-003	O-RING 9.5MM×1.9MM
	12155-ZV5-000	ANODE METAL(2pcs required)
	93500-060184J	SCREW PAN 6×12 (2pcs required)

Warranty Application

Warranty Applications: Ordinary
Claim Type: 000 Standard Warranty
Symptom Code: 03203

L.O.N	Description	FRT
3131C0	Exhaust Manifold Left	1.2
6211A6	Electronic Control Unit(ECU)	0.5
312175	O2 sensor	0.4

Main causal parts: 35655-ZY3-C01 SENSOR, OXY-GEN

Distribution Level

Issue Bulletin

Distributor Code(s)

101, 120, 130, 25F, 302, 33N, 34M, 350, 374, 378, 404, 504, 507, 508, 511, 522, 530, 53S, 550, 557, 564, 577, 62A, 741, 771