



Model	Model Code	Model Type
BF2.3DK2	BAVJ	
BF2DK2	BZBF	

Authorized by MATSUMURA HIROYUKI
Power Product Service Engineering Department, Honda Motor Co.,Ltd

History

Final CAAB06 Applicable VIN revision
Provisional

05/Nov/2012
09/Jul/2012

Related QIC Report Number(s)

6AH2011048-00


Engine Hard Start /Rough Idle and stall

Symptom

The engine was hard to start and during warm up engine idle was rough then finally engine was stalled.

Causes

We found problem which idle and from 3,000rpm decelerating timing A/F was too lean. Throttle valve full close clearance was narrow.

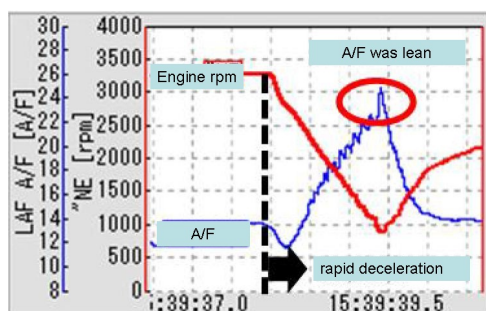

Countermeasure

Carburetor specification will be changed(Apply BF2.3 carburetor assy.). Idle A/F specification will be changed as follow,

	Idle A/F
Current	17.8+/-2.7
Countermeasure	15.6+/-2.3

Application on Production Line

Applied Date	Dest.	VIN	COMMENT
14/Sep/2012		BZBF - 2401798	BF2DK2
14/Sep/2012		BAVJ - 2309512	BF2.3DK2

Market Treatment

Fix as fail.

Repair Method

In case customer complaint rough idle or engine stall symptom please make sure symptom then replace whole carburetor assy. please refer shop manual.

Parts Information

Region	C/M Parts number	Description
US/ CANADA / EU	16100-ZW6-E11	CARBURETOR ASSY
General	16100-ZW6-073	CARBURETOR ASSY



Warranty Application

Warranty Applications: Ordinary
Claim Type: 000 Standard Warranty
Symptom Code: 09103

L.O.N	Description	FRT
3111F3	Carbureter	0.2

Causal Parts Number:

Region	Causal Parts Number
US/ Canada / EU	16100-ZW6-G01
General	16100-ZW6-063

Distribution Level

Distributor only

Distributor Code(s)

101, 120, 130, 25F, 302, 33N, 34M, 350, 374, 378, 404,
504, 507, 508, 511, 522, 530, 53S, 550, 557, 564, 577,
62A, 741, 771