

Model	Model Code	Model Type
BF8DK3	BAAJ	
BF9.9DK2	BABJ	
BFP15DK3	BALJ	
BFP20DK3	BAMJ	

Authorized by MATSUMURA HIROYUKI
Power Product Service Engineering Department, Honda Motor Co.,Ltd

History

Final

10/Aug/2012

Related QIC Report Number(s)


Engine rpm did not increase

Symptom

When install outboard engine on boat at DLR. During trial test engine rpm did not increase. Customer notice water flow is low from cooling water check hole.

Causes

During production process water pump liner did not install proper position in pump impeller housing assy. Water pump liner rotated in housing then clogged cooling water outlet port.

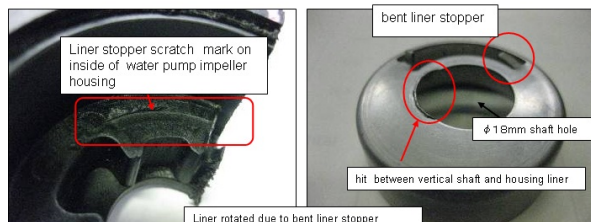

Application on Production Line

Applied Date	Dest.	VIN	COMMENT
31/Jul/2012		BAAJ-1701097	BF8DK3
31/Jul/2012		BABJ-1801109	BF9.9DK2
27/Jul/2012		BALJ-1502130	BF15DK3
27/Jul/2012		BAMJ-1504711	BF20DK3

Market Treatment

Fix as failed.

Repair Method

Please refer to shop manual.

Parts Information

Parts Number	Description
19215-ZW9-020	HOUSING ASSY,IMPELLER

C/M parts number same as causal parts number.

Countermeasure

Production process was modified.



Warranty Application

Warranty Applications: Ordinary
Claim Type: 000 Standard Warranty
Symptom Code: 07400

L.O.N	Description	FRT
1141B6	HOUSING IMPELLER	0.6

Causal Parts number :19215-ZW9-020

Distribution Level

Distributor only

Distributor Code(s)

101, 120, 130, 25F, 302, 33N, 34M, 350, 374, 378, 404,
504, 507, 508, 511, 522, 530, 53S, 550, 557, 564, 577,
62A, 741, 771