

Model	Model Code	Model Type
BF250A	BBJJ	

Authorized by MATSUMURA HIROYUKI
Power Product Service Engineering Department, Honda Motor Co.,Ltd

History

Final	CAAB13	Additional QIC Identification	11/Jan/2013
	CAAB07	Market Treatment revision	
Updated	CAAB13	Additional QIC Identification	19/Nov/2012
	CAAB06	Applicable VIN revision	
Provisional			02/Oct/2012

Related QIC Report Number(s)

6AH2012042-00, 6ASH2012018-00, 6ASH2012018-01, 6CH2012009-00

Salt Accumulation

Symptom


Salt accumulation on various engine parts and inside the engine air intake system.



Causes

Due to lack of water proof sealant on inner cover, Inner cover sealant did not perform then water leaked to inside of engine.


Water leak test

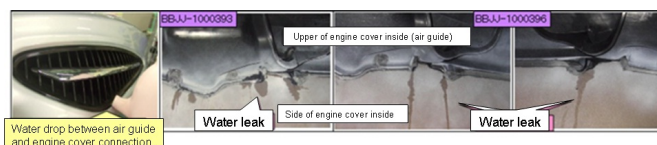

Countermeasure

Countermeasure 1

Apply sealant on inner hood cover.(factory forgot to apply sealant)

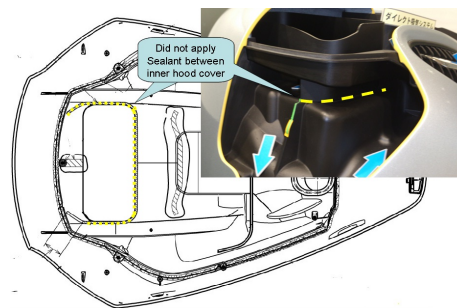

Countermeasure 2


Apply sealant 2 times on inner cover for water proof performance up.



Application on Production Line

Applied Date	Dest.	VIN	COMMENT
23/Aug/2012		BBJJ-1001359	BF250A
23/Aug/2012		BBJJ-8000402	BF250A

Countermeasure engine hood cover indicated paint mark as following area,

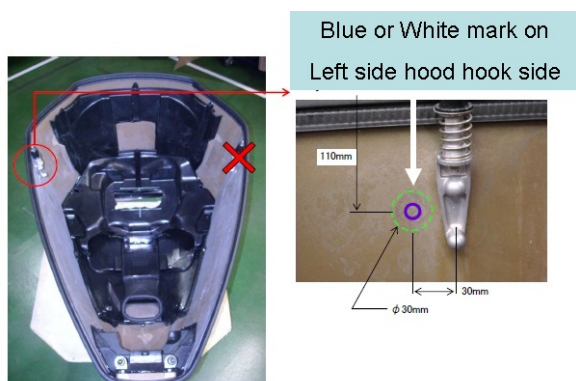

Market Treatment

Fix as failed.

Please conduct engine appearance check during initial 20 hours or 100 hours regular service period at dealer. In case of there is any salt deposit or in case of customer is using outboard engine on heavy ocean waves area, please replace to C/M engine hood cover after cleaning the engine.

Parts Information

Parts number	Description
63100-ZX2-C00ZA	COVER, ENGINE

*C/M Parts number is not changed from failed parts number.

Warranty Application

Warranty Applications: Ordinary
Claim Type: 000 Standard Warranty
Symptom Code: 09900

L.O.N	Description	FRT
4141B4	Engine Cover	0.2

Causal parts number :63100-ZX2-C00ZA Engine Cover Assy.

Distribution Level

Issue Bulletin

Distributor Code(s)

101, 120, 130, 25F, 302, 33N, 34M, 350, 374, 378, 404, 504, 507, 508, 511, 522, 530, 53S, 550, 557, 564, 577, 62A, 741, 771