



Model	Model Code	Model Type
BF175AK1	BAJJ,BAKJ	
BF200A6	BAEJ,BAFJ	
BF225AK1	BAGJ,BAHJ	

Authorized by MATSUMURA HIROYUKI
Power Product Service Engineering Department, Honda Motor Co.,Ltd

History

Updated	CAAB13	Additional QIC Identification	15/Oct/2012
Updated	CAAB13	Additional QIC Identification	20/Aug/2012
Updated	CZZZ99	Other	15/Nov/2011
Provisional	CZZZ99	Other	30/Jul/2011

Related QIC Report Number(s)

6AH2012036-00, 6ASH2011008-00, 6ASH2011008-02, 6ASH2011008-03, 6ASH2011008-04, 6AUH2011004-00, 6HME2011037-00, 6OMC2012002-00, 6OMC2012005-00, 6OMC2012005-01, 6SEM2011007-00, 6SEM2011007-01, 6SEM2012009-02, 6SEM2012009-03, 6SEM2012009-05, 6SEM2012009-07, 6SEM2012009-08, 6SEM2012009-11, 6SEM2012009-12, 6SEM2012009-13, 6UAE2011002-00

After countermeasure O2 sensor failure

Symptom


Dearler check by Dr.H and found that O2 sensor failure, after removed O2 sensor from engine O2 sensor element was found cracked

Causes

Protector exhaust introduction hole at end was leading directly to element, so sea water mist enters directly into sensor element, leading to rapid decrease of element temperature and O2 sensor element cracked.

Countermeasure

Change O2 sensor position (also change exhaust manifold position structure) in order to not to immersion against water.

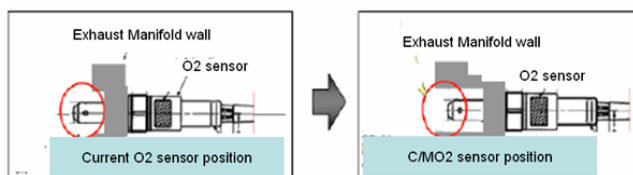

Affected VIN Range

Model		Frame No. Range	
BF175	BAJJ	1300097	1300202
BF175	BAKJ	1300001	1300002
BF200	BAEJ	1600222	1600589
BF200	BAFJ	1600032	1600086
BF225	BAGJ	1601114	1602588
BF225	BAHJ	1600424	1600820

Application on Production Line

2011/06/06 BF175 BAJJ-1300203
2011/06/06 BF175C/R BAKJ-1300003
2011/06/06 BF200 BAEJ-1600590
2011/06/06 BF200 BAFJ-1600087
2011/06/03 BF225 BAGJ-1602589
2011/06/03 BF225C/R BAHJ-1600821

Market Treatment

Fix as failed.

Repair Method

Replace to countermeasure O2 sensor KIT (including



exhaust manifold). Now arranging to set up O2 sensor KIT, inform later.

Parts Information

Inform later.

Warranty Application

Warranty Applications: Ordinary

Claim Type: 000 Standard Warranty

Symptom Code: 03203

Main casual parts: 35655-ZY3-C01 SENSOR, OXY-GEN

Distribution Level

Distributor only

Distributor Code(s)

101, 120, 130, 25F, 302, 33N, 34M, 350, 374, 378, 404, 504, 507, 508, 511, 522, 530, 53S, 550, 557, 564, 577, 62A, 741, 771